TNZ M/4 : 2006 AP40
TEST REPORT

Project :	Quality Assurance
Location :	Production Stock
Client :	Road Metals Company Limited
Contractor :	Various
Sampled by :	David Ohs (Road Metals)
Date sampled :	14 April 2024
Sampling method :	NZS 4407: 2015 (2.4.6.3.2)
Sample description :	NZTA M/4 AP40
Sample condition :	Damp as received
Source :	Waimakariri Quarry

Project No :	6-JRMCO.16/6LC
Lab Ref No :	CH12694
Client Ref No :	Chris Newcombe

Particle Size Distribution

Sieve Size (mm)	Percentage Passing Sample	Limits
63.0	-	100 - 100
37.5	100	100 - 100
19.0	73	66 - 81
9.5	50	43 - 57
4.75	39	28 - 43
2.36	29	19 - 33
1.18	21	12 - 25
0.600	17	7 - 19
0.300	14	3 - 14
0.150	10	0 - 10
0.075	7	0 - 7

% passing the finest sieve is obtained by difference

Grading Shape Control

Fraction (mm)	% Within Fraction Sample	Limits
19.0 - 4.75	34	28 - 48
9.5 - 2.36	21	14 - 34
4.75 - 1.18	18	7 - 27
2.36 - 0.600	12	6 - 22
1.18 - 0.300	7	5 - 19
0.600 - 0.150	7	2 - 14

Crushing Resistance

% Fines @ Spec. Load	-	%
Specification	-	%
Crushing Resistance	-	kN
Nom Aggregate Size	-	mm
Specified Load	-	kN

Broken Faces Content of Aggregate

Fraction (mm)	Percentage by Weight Sample	Lower Limit
37.5 - 19.0	93	70
19.0 - 9.5	97	70
9.5 - 4.75	97	70

Plasticity Index

Sample PI	Non Plastic
Specification	<= 5

Clay Index

Sample CI	0.5
Specification	<= 3

Sand Equivalent (Washed, Mechanical Shaking)

Sample SE	30
Specified	>= 40

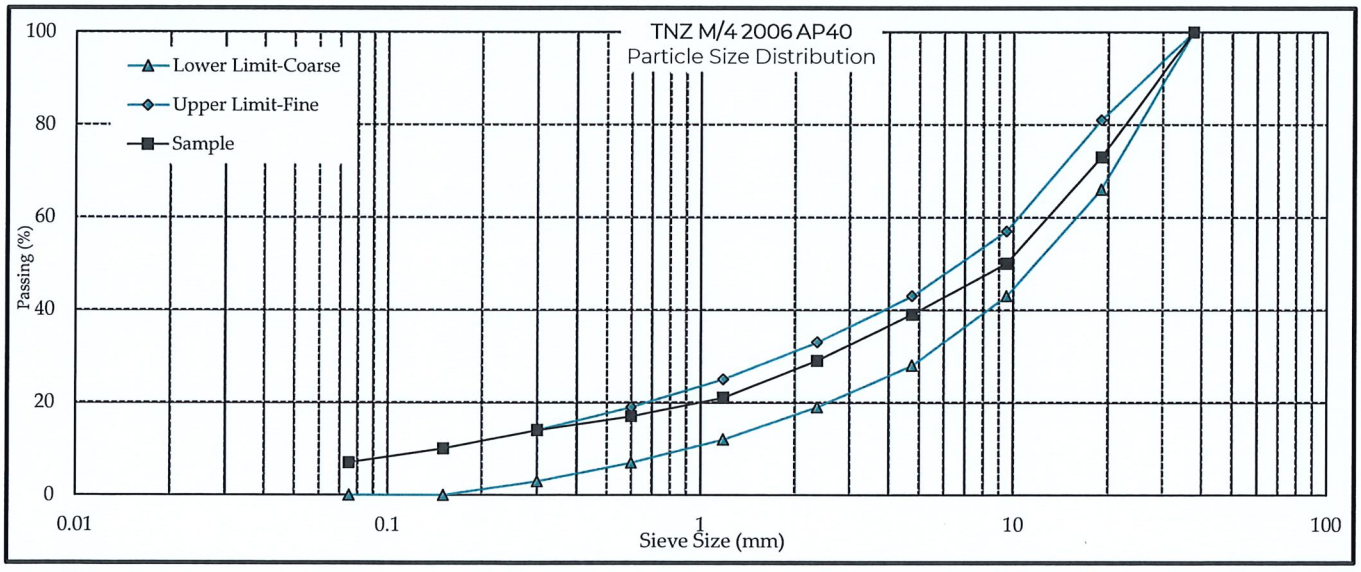

Test Methods

Plasticity Index	NZS 4407 : 2015 : Test 3.4		
Sand Equivalent	NZS 4407 : 2015 : Test 3.6	Broken Faces Content of Aggregate	NZS 4407 : 2015 : Test 3.14
Particle Size Distribution	NZS 4407 : 2015 : Test 3.8.1	Clay Index	NZS 4407 : 2015 : Test 3.5

Date tested : 20 May 2025
Date reported : 23 May 2025

Sampling is covered by IANZ Accreditation
This report may only be reproduced in full
All information supplied by Client

Approved Signatory

Designation : *Laboratory Manager*
Date : 23 May 2025

ACCREDITED IANZ TESTING LABORATORY

All tests reported herein have been performed in accordance with the laboratory's scope of accreditation

WSP
Christchurch (Hayton Rd)
Quality Management Systems Certified to ISO 9001

52C Hayton Rd
PO Box 1482, Christchurch Mail Centre, 8140,
Christchurch, New Zealand

Telephone 03 343 0739
Website www.wsp.com/nz

DRY DENSITY / WATER CONTENT RELATIONSHIP
VIBRATING COMPACTION

Project :	Quality Assurance
Location :	Production Stock
Client :	Road Metals Company Limited
Contractor :	Various
Sampled by :	David Ohs (Road Metals)
Date sampled :	14 April 2025
Sampling method :	NZS 4407: 2015 (2.4.6.3.2)
Sample description :	NZTA M/4 AP40
Sample condition :	Damp as received
Solid density :	2.68 t/m³ (Assumed)
Source :	Waimakariri River Quarry

Project No :	6-JRMCO.16/6LC
Lab Ref No :	CH12694
Client Ref No :	Chris Newcombe

Test Results

Maximum dry density	2.30 t/m³	Natural water content	2.7 %
Optimum water content	4.6 %	Fraction tested	Whole

Sample ID		NAT	+1%	+2%	+3%	+4%		
Bulk density	t/m³	2.283	2.336	2.370	2.405	2.398		
Water content	%	2.7	3.6	4.0	4.6	5.2		
Dry density	t/m³	2.223	2.255	2.278	2.299	2.278		
Sample condition		Moist Hard	Wet Firm	Wet Firm	Wet Firm	Saturated Firm		

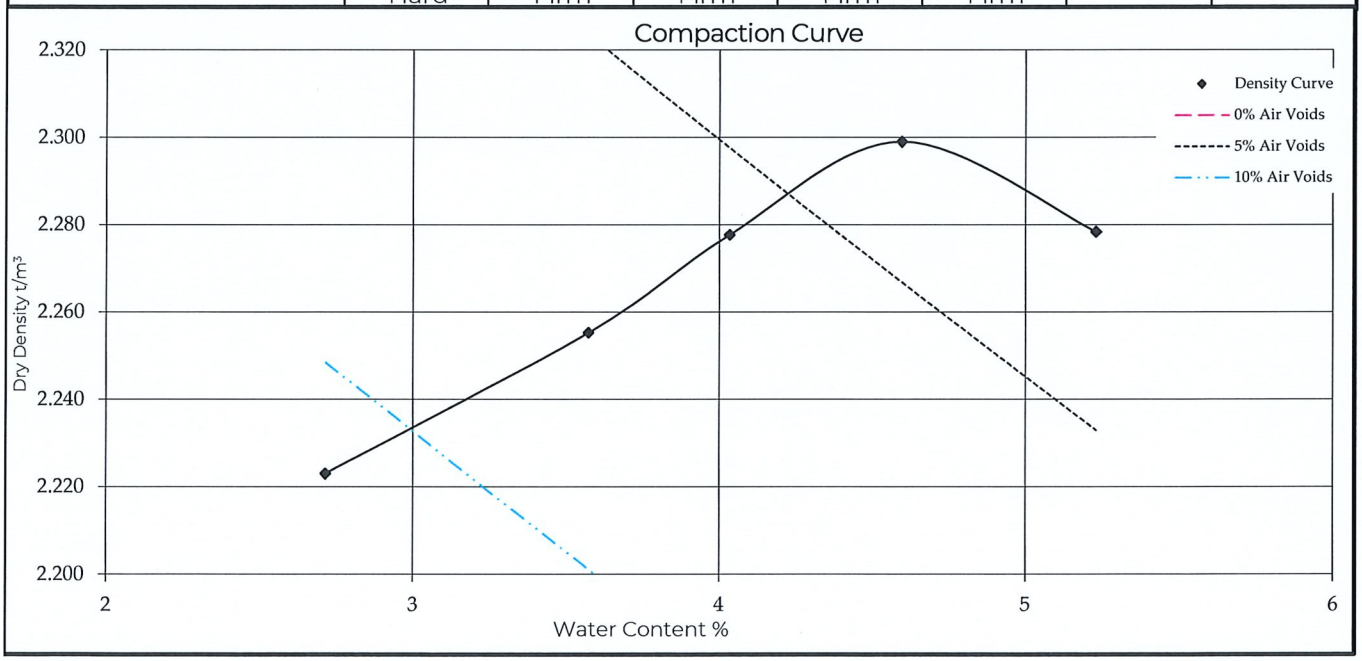

Test Methods		Notes
Compaction	NZS 4402 : 1986 : Test 4.1.3	All information supplied by Client

Date tested : 14 May 2025
Date reported : 23 May 2025

Sampling is covered by IANZ Accreditation
This report may only be reproduced in full

Approved Signatory

Designation : *Laboratory Manager*
Date : 23 May 2025

ACCREDITED IANZ TESTING LABORATORY

All tests reported herein have been performed in accordance with the laboratory's scope of accreditation

WSP
Christchurch (Hayton Rd)
Quality Management Systems Certified to ISO 9001

52C Hayton Rd
PO Box 1482, Christchurch Mail Centre,
8140, Christchurch, New Zealand

Telephone 03 343 0739
Website www.wsp.com/nz